





# Research and Development Technical Report ECOM-75-0146-F

# TRANSISTORIZED RF POWER AMPLIFIER AND DRIVER for RECEIVER-TRANSMITTERS RT-246/VRC and RT-524/VRC FINAL REPORT

by B. WILLIAMS


**JUNE 1976** 

**DISTRIBUTION STATEMENT** 

Approved for public release; distribution unlimited.

# ECOM

UNITED STATES ARMY ELECTRONICS COMMAND-FORT MONMOUTH, N.J. CONTRACT DAAB07-75-C-0146 HARRIS CORPORATION RF COMMUNICATIONS DIVISION ROCHESTER, NEW YORK

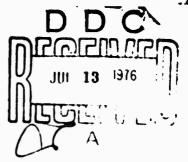

Research and Development Technical Report

ECOM-75-0146-F

TRANSISTORIZED RF POWER AMPLIFIER AND DRIVER FOR RECEIVER TRANSMITTERS RT-246/VRC and RT-524/VRC

B. Williams
Harris Corporation
RF Communications Division
Rochester, New York 14610

JUNE 1976

Final Report for Period September 1975 to March 1976

### Distribution Statement

Approved for public release; distribution unlimited.

Prepared for

**ECOM** 

US ARMY ELECTRONICS COMMAND FORT MONMOUTH, NEW JERSEY 07703

### NOTICES


### Disclaimers

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

The citation of trade names and names of manufacturers in this report is not to be construed as official Government endorsement or approval of commercial products or services referenced herein.

### Disposition

Destroy this report when it is no longer needed. Do not return it to the originator.

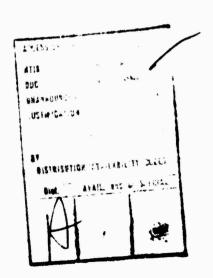

	READ INSTRUCTIONS BEFORE COMPLETING FOR
ECOM-75-\$146-F	O. RECIPIENT'S CATALOG NUMBER
TRANSISTORIZED RF POWER AMPLIFIER AND DRIVER FOR RECEIVER TRANSMITTERS	EINAL YEPT. SEP 75 - MAR 76,
RT-246/VRC AND RT-524/VRC	A. CONTRACT OF GRANT NUMBER (1)
B./Williams	DAABØ7-75-C-Ø146
The Performing Organization name and address HARRIS CORP., RF COMMUNICATIONS DIV. 1680 UNIVERSITY AVENUE ROCHESTER, NEW YORK 14610	10. PROGRAM ELEMENT, PROJECT, T AREX & WORK UNIT HUMBERS 697348P¥3613401
US ARMY ELECTRONIC COMMAND	JUNE 1976
FORT MCNMOUTH, N.J. 07703 ATTN: DRSEL-NL-RN-1  18. MONITORING AGENCY NAME & ADDRESS(II different from Controlling Office	36
(19)/40	UNCLASSIFIED
10/14/	15a. DECLASSIFICATION/DOWNGRADS
17. DISTRIBUTION STATEMENT (of the abelract antered in Bloch 30, if different	tran Report)
17. DISTRIBUTION STATEMENT (of the abetract antered in Block 26, if different	ren Repert)
	or)
18. SUPPLEMENTARY NOTES  18. KEY WORDS (Cantinus on reverse side If noccoopy and Identify by block match	on C-12 on work on the transisto

UNCLASSIFIED
SECURITY CLASSIFICATION OF THIS PAGE (Then Date 2)

409567 LB

20. continued

deliverable units were then constructed and tested. Complete performance and temperature tests were run before the three deliverable units were shipped to ECOM for further evaluation.

Data covering the major operating parameters measured during testing is presented in this report.

UNCLASSIFIED

BECUMETY CLASSIFICATION OF THIS PAGE/From Rose Primary

### TABLE OF CONTENTS

Section	<u>Title</u>	Page
	List of Illustrations	ii
1.0	INTRODUCTION	1
2.0	REQUIREMENTS	2
3.0	DESIGN ACCOMPLISHMENTS	3
3.1	Tuner/Driver Assembly	3
3.2	Power Amplifier	7
3.3	High Band Low Pass Filter	9
3.4	Power Supply	12
3.5	Control Circuits	15
3.6	Mechanical Packaging	19
4.0	PERFORMANCE AND DATA	20
4.1	Discussion	20
4.2	RF Output Power Test	21
4.3	Reverse IM Test	21
4.4	Transmitter Noise Level	21
4.5	Spurious and Harmonics	21

### LIST OF ILLUSTRATIONS

Figure No.	<u>Title</u>	Page
3.1-1	Schematic, Driver/PA Retrofit	1.
3.1-2	Tuner/Driver Schematic	5
3.2-1	Power Amplifier Schematic	8
3.3-1	High Band Output Filter	10
3.3-2	High Band Output Filter Attn	11
3.4-1	Power Supply Schematic	13
3.5-1	ALC Assembly Schematic	16
4.2-1	RF Power Output Test Data, Unit #1 .	23
4.2-2	RF Power Output Test Data, Unit #2.	24
4.2-3	RF Power Output Test Data, Unit #3 .	25
4.3-1	Reverse IM Test Data, Unit #1	26
4.3-2	Reverse IM Test Data, Unit #2	27
4.3-3	Reverse IM Test Data, Unit #3	28
4.4-1	Transmitter Noise Level Data, Unit #1	29
4.4-2	Transmitter Noise Level Data, Unit #2	30
4.4-3	Transmitter Noise Level Data, Unit #3	31
4.5-1	Spurious and Harmonic Test Data	32

### 1.0 INTRODUCTION

The purpose of this contract was to develop a design modification to the transmitter/power supply for the Receiver-Transmitter Radio, RT-246/VRC and RT-524/VRC. The objective of this modification was to:

- 1) Increase Reliability
- 2) Minimize broadband noise and harmonic emissions
- 3) Eliminate the high-voltage power supply and vacuum tubes in the Power Amplifier and Driver Assembly.
- 4) Design a low cost conversion kit suitable for retrofit by low-skilled personnel.

This final report will discuss the design and development results achieved during the last reporting period of this contract. This includes a discussion of the Tuner/Driver Assembly, power amplifier, power supply and automatic level control.

### 2.0 REQUIREMENTS

The technical approach is directed toward meeting Specification EL-CP0108-0001A, SCN001 and SCN002 in accordance with the work statement in section F.2 of the contract DAAB07-75-C-0146. Maximum utilization of existing parts is desirable to minimize conversion costs. These include:

- a) Power Amplifier Heat Exchanger
- b) Fan
- c) Fan power supply
- d) Power Amplifier output tank circuit and tuning mechanism
  - e) Transmitter driver assembly tuned circuits
  - f) Low band low pass antenna filter (FL 401)
- g) All transmitter circuitry up to and including the buffer amplifier assembly

The transmitter output tank circuit and driver assembly tuned circuits are retained to achieve the required selectivity necessary to limit the transmitter noise to -140 dB below the carrier. Retention of these three tuned circuits is hased on worst case noise measurements at ECOM of -95 dBm in a 30 kHz bandwidth at the output of the existing RT-524/VRC Transmitter Buffer.

### 3.0 DESIGN ACCOMPLISHMENTS

### 3.1 Tuner/Driver Assembly


The Tuner Driver Assembly mounts on a tube socket plug which fits directly into the socket that is presently used by the driver vacuum tube. The solid state amplifier mounts to the heat sink partition where the removed tube shield presently clips.

Deletion of tube associated parts were accomplished as shown in the enclosed original schematic Figure 3.1-1. The inductuner has been retained to preserve selectivity. Retaining the tuned circuits was essential to meet the transmitter noise specifications as shown in the gain distribution data contained in the last quarterly report.

The basic Tuner/Driver circuitry (Figure 3.1-2) has been altered to include a few additions. A forward biased hot carrier diode, CRl, has been added at the base of the input stage to compensate for cold environmental conditions. The addition of the diode allows the transistor to operate somewhere between Class B and Class C rather than hard Class C. Inductor Ll, which is in series with CRl, is a broadband ferrite choke which furnishes an RF impedance of 750 ohms to the signal path. Capacitor Cl was also changed from 5 pF to 7 pF. This value was optimized to furnish greater drive power to the input stage without compromising the loading to the inductuner.

Another addition to the circuitry was a feedback path between the collector and base of the driver stage Q3. L4, C13 and R9 was added to stabilize the operation of Q3 at the upper end of band "B".

The minor changes outlined in this paragraph did not

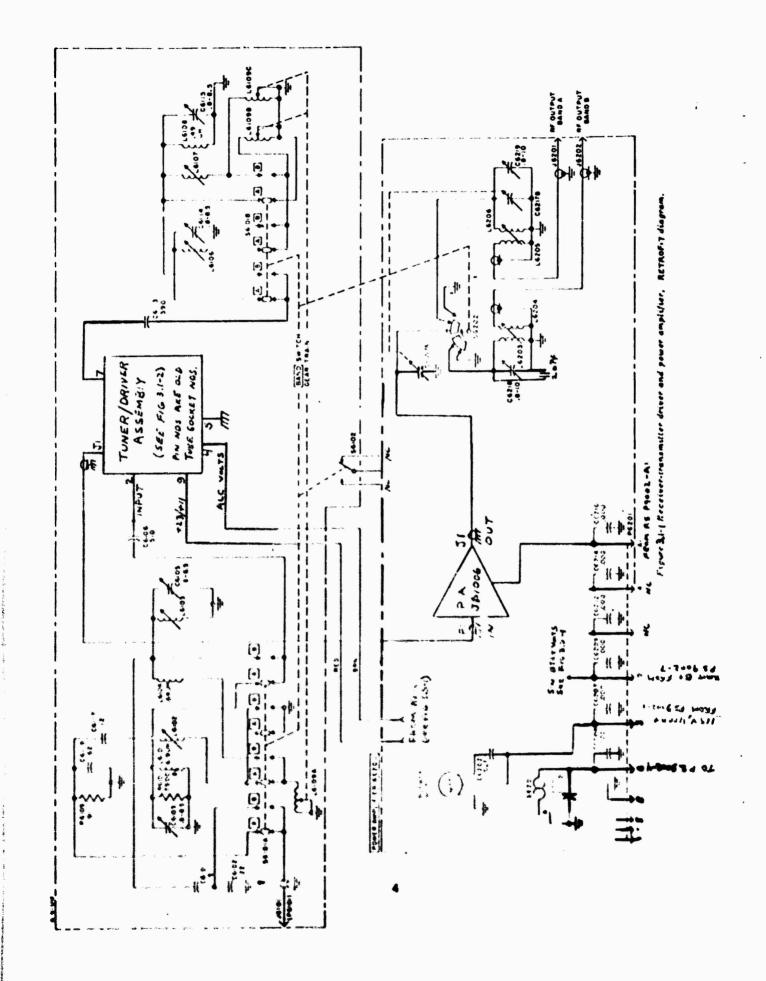

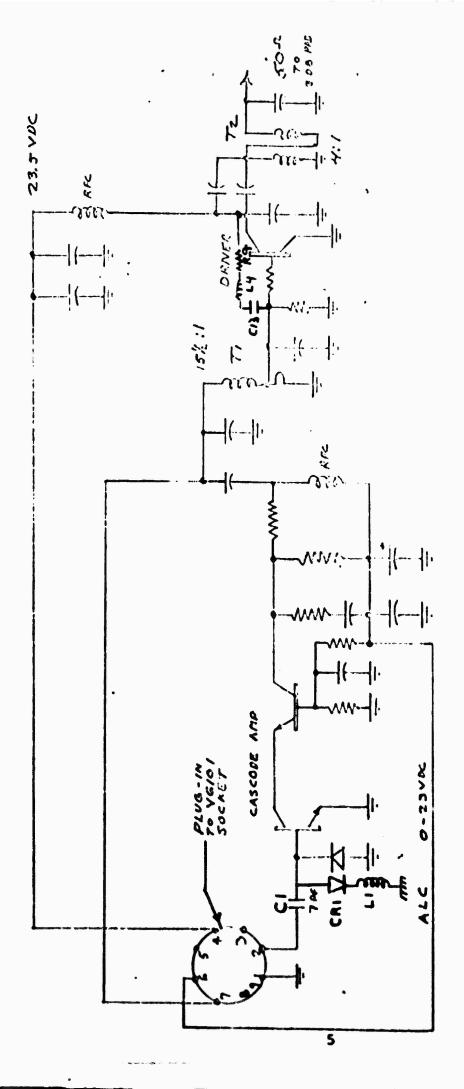


FIGURE 3.1-2 SOLID STATE AMPLIFIER TUNNER / DRIVER HISSER

alter the operating characteristics of the Tuner/Driver Assembly to any noticeable degree. The data furnished in the last quarterly report concerning this assembly remains valid.


### 3.2 Power Amplifier

The single ended power amplifier approach has been maintained and successfully implemented in the system. The TRW JØ1006 transistor has been retained and has proven to be a reliable device for the required design. The circuitry described in the last quarterly report has been modified only slightly (Figure 3.2-1).

Previously a resistor divider at the output of the driver stage was used to isolate the driver output from the power amplifier input. The divider has now been placed in the power amplifier assembly in the form of a 3 dB thick film pad. The pad is heat sunk to the power amplifier chassis. To compensate for gain at the higher frequencies where the PA gain is less, a 150 pF capacitor is shunted across the pad to provide sufficient drive level at the higher frequencies.

The output tank circuit was modified to improve selectivity, reverse IM, and reduce output noise. The pickup coil for each band was made smaller and an extra turn added. The form of the coil was also altered to allow the coil position to be varied inside the tank coil.

The tap on the tank coil was maintained at the same point as before. The resulting performance showing the output power, IM and noise data are shown in Section 4.

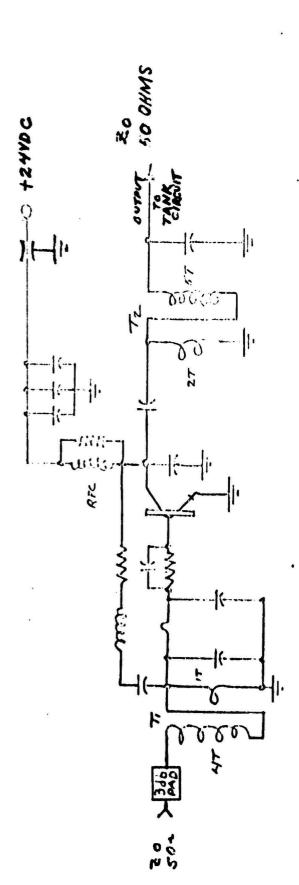


POWER AMPLIFIER

Figure 3.2-1

### 3.3 High Band Low Pass Filter

The high band low pass filter, supplied by ECOM, has been installed on the A9000 module. This filter was necessary to meet the harmonic specification during High Band (Band "B") operation. The schematic and response of the filter is shown in Figure 3.3-1 and Figure 3.3-2.

# HICH BAND OUTPUT FILTER

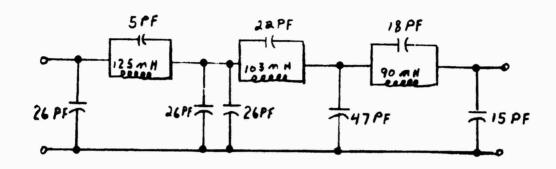

# REQUIREMENTS

Zim = Zwi = 50 OHMS


3dB CUT OFF FREQ = 78 MHZ

ATTENUATION= 

LESS Than 1dB BELOW 76 MNZ

50 dB CR GREATER (106 - 500) MHZ

F16. 3.3-1

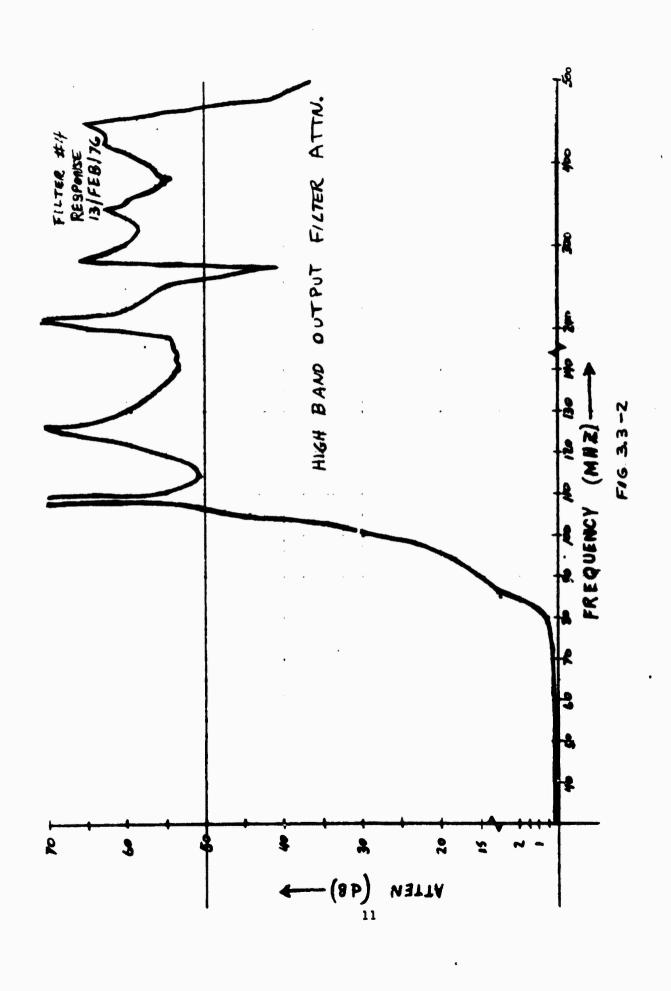

### 3.4 Power Supply

The power supply for the power amplifier provides voltage regulation at 24 volts and current limits to protect the power amplifier transistor. The power supply, as described in the last quarterly report, has remained the same mechanically and electrically except for the setting of the current limiting. The previous current limiting which was set at 4.5 amps is now set for 5.5 amps. The voltage to the power amplifier reduces rapidly from 24 volts to approximately 4 volts as the current exceeds 5.5 amps.

The power supply is shown in Figure 3.4-1. The output voltage is nominally at 24 volts in high power operation. A 27 volt zener diode (1N2988B) on the regulator board serves as a reference. The .17 ohm, 10 watt resistor in the collector circuit of regulator transistor Q1 (2N5302) serves to sample the output current. Once the voltage drop accross the 0.17 ohm resistor approaches 0.6 volts, it is fed to E7 of the regulator board through the temperature compensating thermistor network turning on the 2N2905 transistor. This action causes Q3 to conduct which lowers the voltage on the bases of Q2 and regulator transistor Q1. The emitter of Q1 follows and reduces the output voltage to the power amplifier.

During low power operation, the 24 volt reference to the base of Ql transistor is reduced when the low power ground is introduced through pin 15 of P9002. This furnished ground causes the lN2975B zener diode to conduct applying an ll volt reference to the voltage regulator when it shunts out the higher voltage 27 volt zener diode.

The other power transistors on the power supply heat

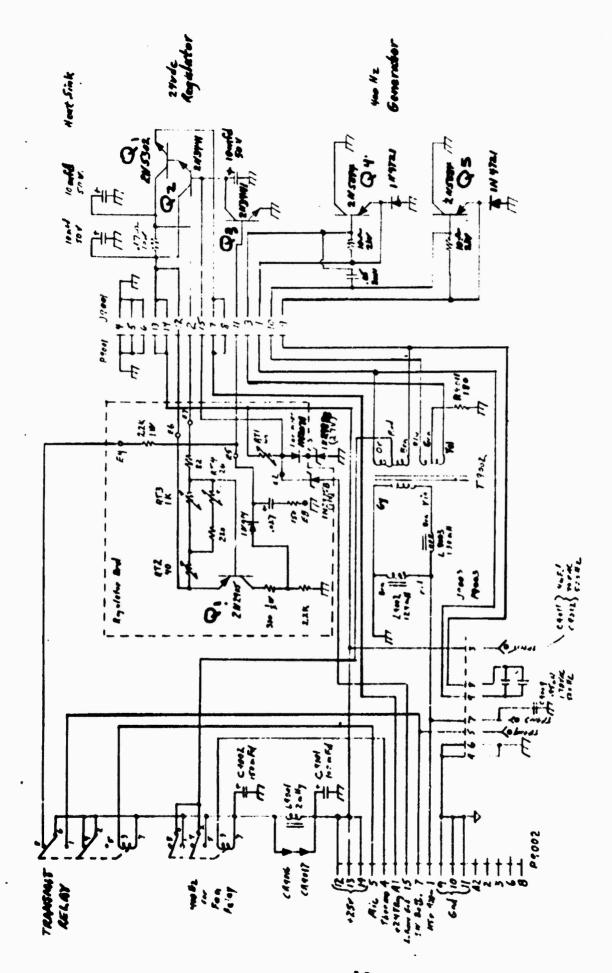


FIG. 3.4-1 POWER SUPPLY SCHEMATIC

sink are Q4 and Q5. This circuit is the 400 Hz power oscillator which supplies the power for the fan located on the power amplifier heat sink. This circuit retains its original form with the exception of the change in transistors. The germanium devices have been replaced with silicon transistors. Diodes were added in the emitters to clamp the negative swings from the transformer to ground.

Also shown on the schematic are the transmit and fan relays which are an integral part of the present radio, but shown here to illustrate the system integration of the power supply.

The fan is thermostatically controlled to operate at +150°F. (Note that this feature is presently available in the existing VRC-12.) In a hostile environment it may be desirable in some instances to disconnect the fan operation to avoid detection. For this purpose, a disconnect is provided. It is tagged and clearly visible after removal of the top cover.


### 3.5 Control Circuits

The Automatic Level Control (ALC) circuitry is used to level the power from 30 MHz to 76 MHz. This portion of the development program was modified somewhat since the last quarterly report. The concept is basically the same, however a second loop has been added. This new loop controls the RF drive level for optimum efficiency.

Refer to Figure 3.5-1 for a schematic diagram of the ALC and its associated circuitry.

The regulator mounted on a heat sink is comprised of two 2N3441 transistors. Transistor Q1 furnishes either +23 volts in the high power mode or +11 volts in the low power mode. The voltage is selected for high power at +24 volts when the +24 volt zener diode 1N2986 is used. During low power selection, the anode of the 11 volt zener is grounded through the Hi/Low power relay which causes the zener to conduct and shunts out the 24 volt reference with an 11 volt reference. The output from Q1 provides the collector voltage of the driver transistor on the Tuner/Driver Assembly. Another output from Q1 is used as a reference voltage on the ALC board at E2.

The power bridge is similar to the one described in the last quarterly report. The only difference is that the diode is forward biased from E6 of ALC board. This is necessary because the detected output is fed to an operational amplifier using a single polarity voltage thereby requiring operation above ground. The power bridge is located after the tank circuit to provide a relatively harmonic free signal to be power sampled. The power bridge is the conventional type using the current and voltage

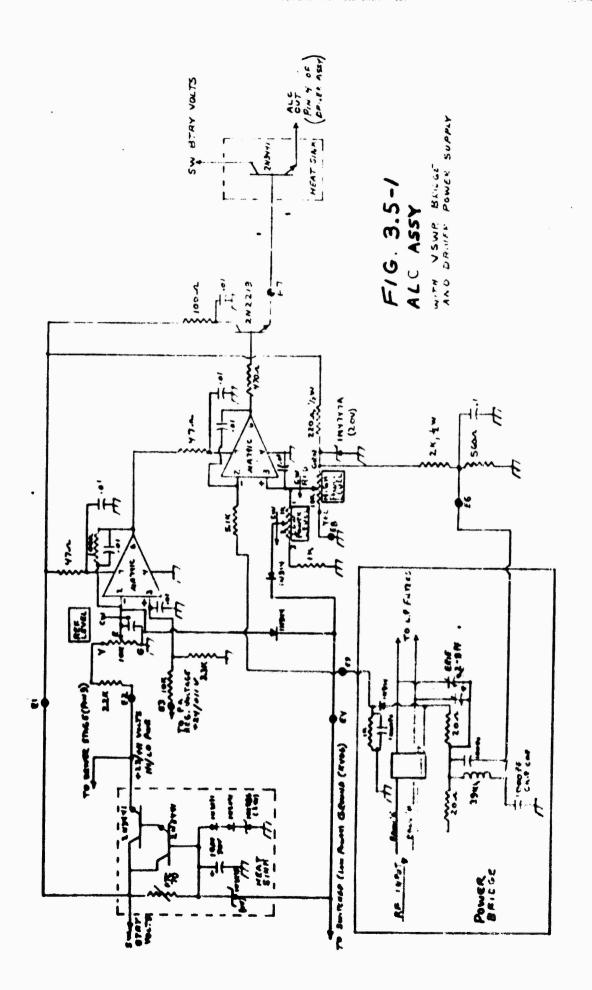

relationship of the signal and rectifying the resultant which is proportional to the forward power when the sense of the windings is correct. The output of the power bridge is filtered and becomes an input to the ALC board at E5.

The ALC board contains two µA74lC operational amplifiers, Al and A2. Two controls are excercised in this circuitry. Amplifier Al controls the B+ to amplifier A2. Amplifier A2 controls the ALC voltage to the cascode amplifier which varies the gain of the driver amplifier.

Assume the B+ to A2 is fixed and High Power operation is selected. The input to pin 3 of A2 is set by the HIGH POWER LEVEL pot whose reference is derived from a 20 volt zener diode. The other input to A2 is from the power bridge and is to pin 2, the inverting input. As long as the voltage from the power bridge is below that of the reference level set at pin 3, A2, which is acting as a threshold detector, will be latched in a positive direction thereby applying full B+ to the output at E7. This output drives an emitter follower, a heatsunk 2N3441, to furnish the ALC voltage to the mascode amplifier stage. When the voltage from the power bridge exceeds the level set at pin 3 of A2, the amplifier tends to switch toward ground to lower the voltage supplied to the cascode amplifier and thereby lowers the gain. The high gain loop acts instantaneously to lower the power which lowers the voltage at pin 2 since the voltage is a function of the output power level.

During LOW POWER operation, the wiper of the LOW POWER LEVEL pot is grounded by the Hi/Low power relay. This reduces the reference level at pin 3 by shunting less resistance across the

wiper of the HIGH POWER LEVEL pot. This causes A2 to supply a lower voltage in accordance with the LOW POWER LEVEL setting.

The operation of A2 discussed to this point assumes the B+ supplied from Al to be fixed which is not always the case. The output of Al is controlled in a similar manner discussed for A2. The REF LEVEL pot is set at a level to be compared against a divided output voltage supplied to the power amplifier from its power supply. When excessive current is drawn, this voltage drops as a function of overload current. The function of Al then is to lower the drive voltage to the cascode amplifier by dropping the B+ to Al. This is necessary since A2 would continue to furnish maximum ALC voltage if the preset level was not reached. But, the PA would be unable to deliver the power since a foldback condition of the power supply would only allow 3 or 4 volts on the collector of the PA. A stalemate condition with maximum current would result. Therefore a compromise condition had to be reached. The REFURENCE LEVEL is set to allow the power supply to drop to a minimum of 22 volts. The power obtained under this condition will be the maximum without increased transistor dissipation. This control of Al also serves to protect the PA transistor under short or open circuit loads. The gain of Al is controlled by a feedback resistor set for a nominal gain of 10. This circuit arrangement prevents an unstable condition should Al and A2 both exercise control simultaneously.

### 3.6 Mechanical Packaging

The modifications described in this report are of such a design as to be implemented as a retrofit kit into the present equipment by low skilled personnel. All controls and operation of the equipment remain unchanged.

The replacement circuitry has been designed to directly interchange with the present radio by replacing the power supply module and associated heat sink assembly and the transmitter-driver and power amplifier module. The present mechanical configurations have been maintained, eliminating the necessity of drilling new holes. The only wiring changes that are required involve two wires on relay K406, and the removal of R401.

A major design accomplishment allows integration of the present controls in the new design. Tracking the amplifier tuning through the present gear assemblies proved to be adequate when the backlash adjustment in the gears are properly set.

### 4.0 PERFORMANCE AND DATA

### 4.1 Discussion

An RT-246/VRC and two RT-524/VRC units were modified with the modules outlined in Section 3. All three were built using the engineering prototype information gained during the research and development stage of the program. Little difficulty was experienced in incorporating this new design into the original units. Tracking the driver and power amplifier tuning with the original front panel controls required some altering of the capacitor plates of the final tank circuit. The greatest problem encountered was in the backlash play of the connecting gear assemblies in the final tank circuit. A hysteresis was noted in this gear assembly that yielded different power readings depending on the direction of rotation when tuning. This problem, which still could occur from over torque at the end points, was minimized through rework of the couplings. The only other problem encountered was the sometimes erratic performance of the synthesizer which failed to properly lock to the programmed frequency.

An acceptance test for conformance to the specifications was run during the week of March 7, 1976. The units were tested to the outlined specifications except for temperature. Only one unit (Unit #3) was tested for temperature at that time due to the cycling time involved in reaching the required stabilized temperatures; however, all three units have been successfully tested over the temperature range prior to the acceptance test. The data taken during the acceptance test is included as part of this report.

### 4.2 RF Power Output Test

This test was performed using a calibrated 50 dB pad and an HP-435A Power Meter. All equipments met the 35 watts minimum power requirement.

### 4.3 Reverse IM Test

This test was run as shown in the diagram on the data sheet. With the forward power set at 40 watts on the RT-524, the interfering power was set for 4 mW delivered to the output jack of the RT-524. Note that Unit #3 did not have the 6 dB pad between the coupler and the transmitter. The 6 dB pad was used to provide a 50 ohm impedance at the transmitter. All units when connected through the 6 dB pad met the 15 dB reverse IM requirement.

### 4.4 Transmitter Noise Level

This test was performed as shown in the diagram on the data sheet. With 40 watts forward power at 62 MHz being delivered from the transmitter under test, attenuation was added in series with the signal to permit use of a sensitive receiver located in a screen room. Additional attenuation was also used in the screen room. After a reference level was determined, a low pass filter with a cutoff of 53 MHz was inserted in the path and attenuation removed. The receiver was tuned to 52 MHz and the signal measured at that frequency. Corrections were made for a 30 kHz bandwidth since the receiver has a 20 kHz bandwidth, and a 1 dB insertion loss at 52 MHz was taken into account as shown on the data sheet. All three equipments met the -140 dB noise requirement.

### 4.5 Spurious and Harmonics

The transmitter was checked for spurious and harmonics in the screen room. A notch filter was used to attenuate the carrier into

the analyzer to prevent generation of harmonics in the mixer of the spectrum analyzer. All equipments far exceeded the 60 dB requirement for 2nd and 80 dB requirement for all other harmonics.

### Figure 4.2-1

Ser. No. /

# RF POWER OUTPUT TEST (Power in Watts)

Frequency - (MHz)	Ro	oom Temperatu 22 V	re 30 V	-+150°F   -40°F
. I@25V	High   Low	High   Low	High   Low	High High
30 <u>7.2A</u>	44 3.2	41	49	
32 <u>6.</u> 5	44.5 3.2	42	49	
34 6.0	44 3.1	42	49	
36 6.0	46 3,2	43	50	
38 <u>6.6</u>	50 3.4	38	55	
40 6.1	76 2.9	36.5	49	
42 <u>5.8</u>	45 2.9	40	49	
44 6.4	44 2.8	38	48	
46 7.9	45 2.7	34.5	47.5	
48 7.0	42 2.8	30	47	
· 50 <u>6.8</u>	40 2.7	33	44.5	
52 6.2	39.5 1.5	37	44	
52.95 <u>6.3</u>	39 2.4	35	42	
53 7.65	43 3.1	3/	53	
54 <u>7.5</u>	41 3.1	31	52	
56 7.2	43.5 3.0	30	54	
58 6.6	43 3.1	29	53	
60 <u><b>5.9</b></u>	42.5 3.1	29	54	1
62 6.0	40.5 3.1	33	54	
64 5.9	44 3.0	33	54	
66 6.0	44 3.0	3/	54	
68 <u>6. y</u>	Y6.5 2.9	32	53	
70 6.4	47.0 2.9	32	24	
72 6.5	47.5 3.0	33	54.5	
75 <u>6.5</u>	46,0 3,0	33	53.5	
75.95 <u>6.4</u>	42 2.9	<u> 27</u>	53	

### Figure 4.2-2

Ser. No. 2

# RF POWER OUTPUT TEST (Power in Watts)

Frequency	у -		oom Temperatur	e 30 V	-+150°F   -40°F
(MHz)	_ I@25V	25.5 V High   Low	22 V High   Low	High   Low	25.5 V High   High
30	7.0A	44 2.9	40 3.3	50 2.8	
32	7,0	47 3.1	42 3,4	50 3.0	
34	la. 4	48 3	43 3.5	52 3,0	
36	6.8	50 3	45 3.5	5 3 3,5	
38	6.8	45 2.7	4/ 3.2	50 d.8	
40	4.5	43 2.6	38 3.1	49 1.7	
42	6.1	43 2,45	41 3.0	50 2.6	
44	6.0	44 2.6	34.5 3.0	43 2.6	
46	6.2	44 2.5	38 3.0	47.5 2.6	
48	3.0	42.5 2.3	34 2.6	43.5 2.3	
50	7.7	39 2.2	31 2,65	43 2.3	
52	6.4	30 201	34 2.5	42 2.à	
52.95	6.2	38 2.0	33 4.4	41 2.1	
53	5.9	42 2.1	37 2.7	45.5 4.3	
54	6.0	47 3.3	36 2.7	46 2.3	
56	6.0	41 2.2	35 2.7	45 2.3	
58	6.0	41 2.3	34 2.7	45 1.3	
50	6.0	41 2.2	33 2.7	46 2.3	
62	6.0	41.5 = 3	33 2.8	46.53	
64	6.0	47 2.7	32 3.8	47 3.4	
<b>5</b> 6	5.7	42 2.3	30 3.7	17 2.4	
óò	5.8	41 2.2	30 2.6	75 2.4	
70	5.5	3,9.5 €.1	33 25	44.5 2.3	
72	5.4	40 2.1	36 2.5	44 2.2	
75	5.5	40 2.1	32 2.5	43 2.1	
75.95	5.P	40 2.1	26,5 2.5	43 2.1	

Ser. No. 3


# RF POWER OUTPUT TEST (Power in Watts)

Frequence (MHz)	cy -	Ro	oom Temperatui 22 V	re	-+150°F   -40°F
· (Purz)	I@25V	High   Low	High Low	High   Low	High High
30	7.5A	46 3,4	40 3.7	47 3,4	45 40
32	6.5	44.5 3.5	42 3.7 S	47 3,5	52 39
34	6,5	45 3.4	41.5 3.7	48 3,4	51 39
36	7.6	56 5.3	45 5,7	60.5 5,2	52 57
38	7.5	49 3.6	41 3.8	52 3,6	51 44
40	7.0	47 3.2	41.5 3.5	50 3.2	50 41
42	6.8	46 3.2	4/ 3,5	48 3.2	50 40
44	7.2	44 3,2	4/ 3.5	48 3.2	43 41
46	8.2	43 3.1	36 3.2	17 3.1	38 39
48	8. 2	42 2,9	34 3,0	45 2.9	37 36.5
50	6.3	38 2.6	34 2.9	40.5 2.7	42 34.5
52	3.2	38 2.6	35 2.95	41 2.6	43 35.5
52.9	5 7.3	40 2,7	31 2.95	44 2.6	39 37
53	7,3	43 3.5	34 3.4	42 3.1	43 40
54	7.0	44 3.2	33 3.4	47 3.1	40 40
56	6,3	42 3.1	32 3,3	48 3.0	43 39
58	5.6	40-5 3.1	30 3.3	423 3.0	42 34
60	5.5	40 3.0	30 3.2	44 2.95	41 34
62	5.6	41.5 2.8	30 3,2	44 2.9	41 39
64	5.6	41.0 2.9	30 3.1	43 2.85	39 38
66	6.0	41.0 2.8	31 3,0	74 2.8	39 37.5
66	6.3	41.5 2.1	33 3,0	44 2.8	41 37.5
70	6,2	41 3.6	35 3.1	45 2.8	43 38
72	6.0	43 2.9	33.5 3.4	46 2.9	47 36
75	5.8	43 2.9	33 3.1	46 2.5	71 39
75.9	5 5.7	41 2.9	29 3.1	46.5 2.85	37.5 39

Figure 4.3-1

REVERSE IM TEST


Frequency	$F_{INT}$ (-2 MHz)	$F_{INT}$ (+2 MHz)
30	>30db	>30 db
35	24	22
40	20	20
45	24	22
50	<u></u>	25
5 <b>2.95</b>	>30	
53	<u>~ 3</u>	730
55	>38	
60	71	22
65		19
70	22	
75	ک ک	<u>&gt;30</u>
75.95	>30	24

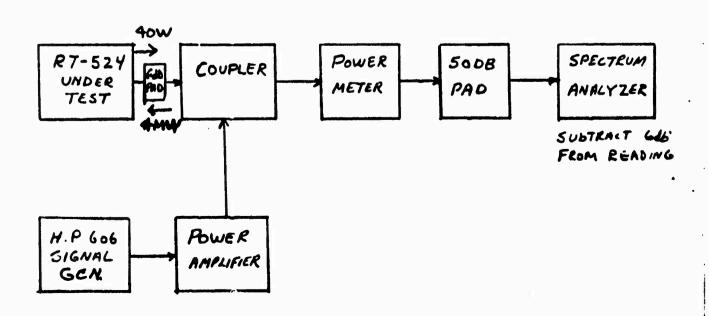

### Ser. No. 2

### REVERSE IM TEST

Frequency	FINT (-2 MHz)	FINT (+2 MHz)
· 30	>30 db	<u> 730db</u>
. 35	25	
40	19	19
45	22	24
50	>30	27
52.95	27	>30
53	730_	24
55	ج ج ح	22
60		- 31
65	2/	77
70	21	
75	24	35
75.95	25	<u></u>

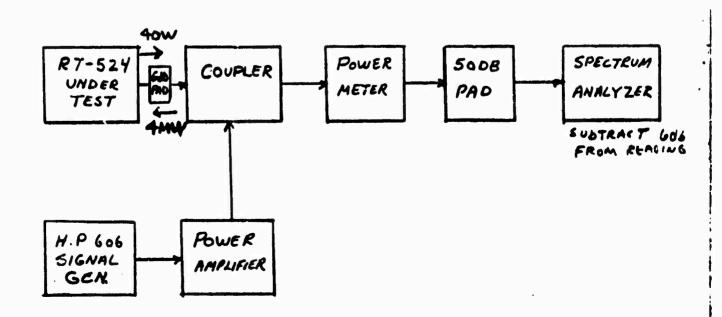



RT-<u>524/VRC</u>

Figure 4.3-3
REVERSE IM TEST

Ser.	No.	3

Frequency	F <sub>INT</sub> (-2 MHz)	FINT (+2 MHz)
30	32 46	32db
35	32	
40	20	10
45		
50	39	23
52.95	- 60	
53	34	35
55	36	<u>~ 4</u>
60		<u>~ ~ 6</u>
65		
70	<del></del>	
75		33
75.95	<u> </u>	30
, , , , ,		

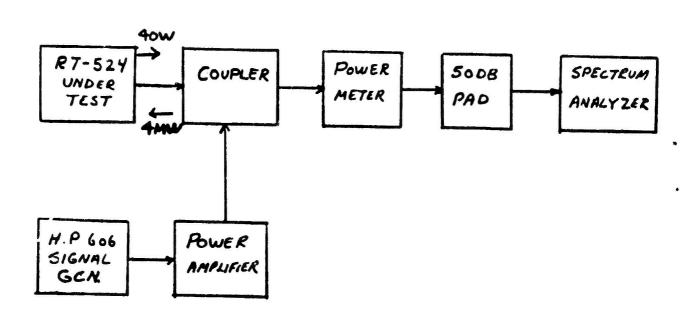

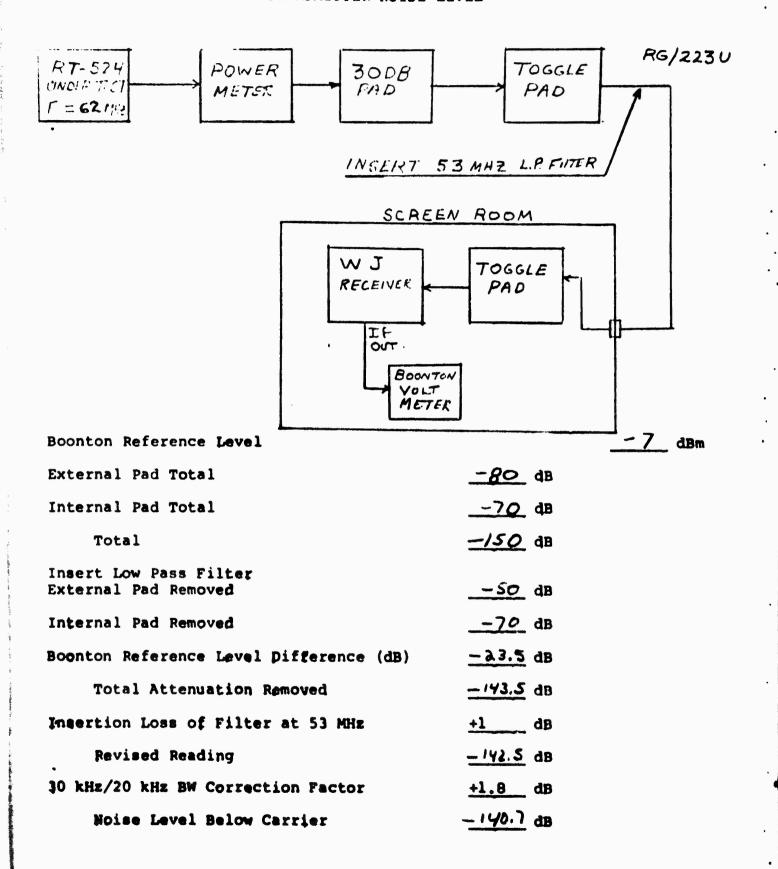

### TRANSMITTER NOISE LEVEL

Ser. No. 2

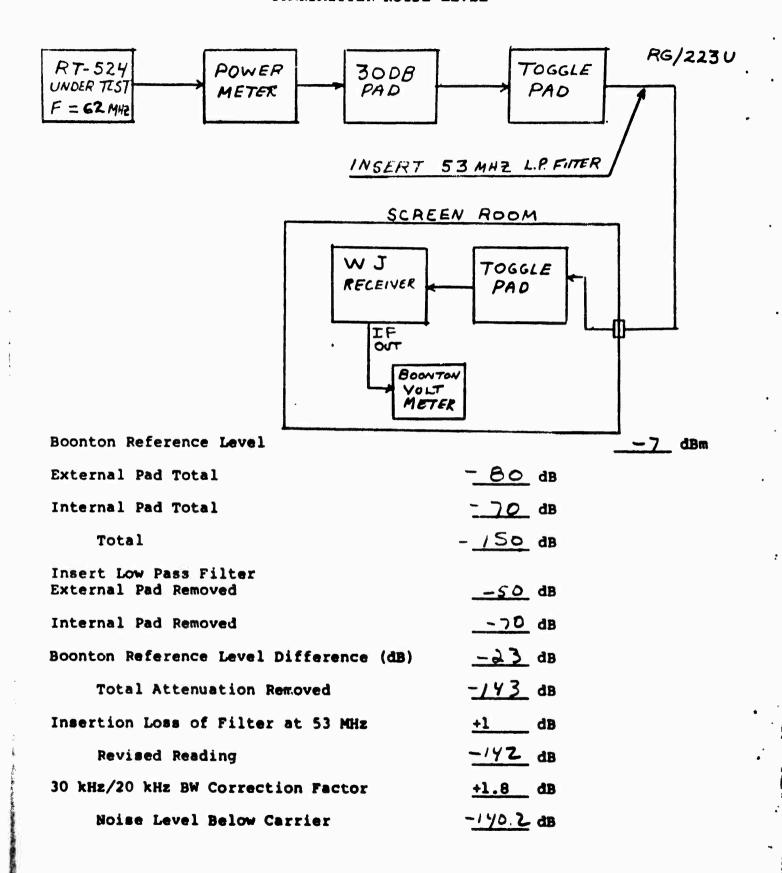


Figure 4.4-3


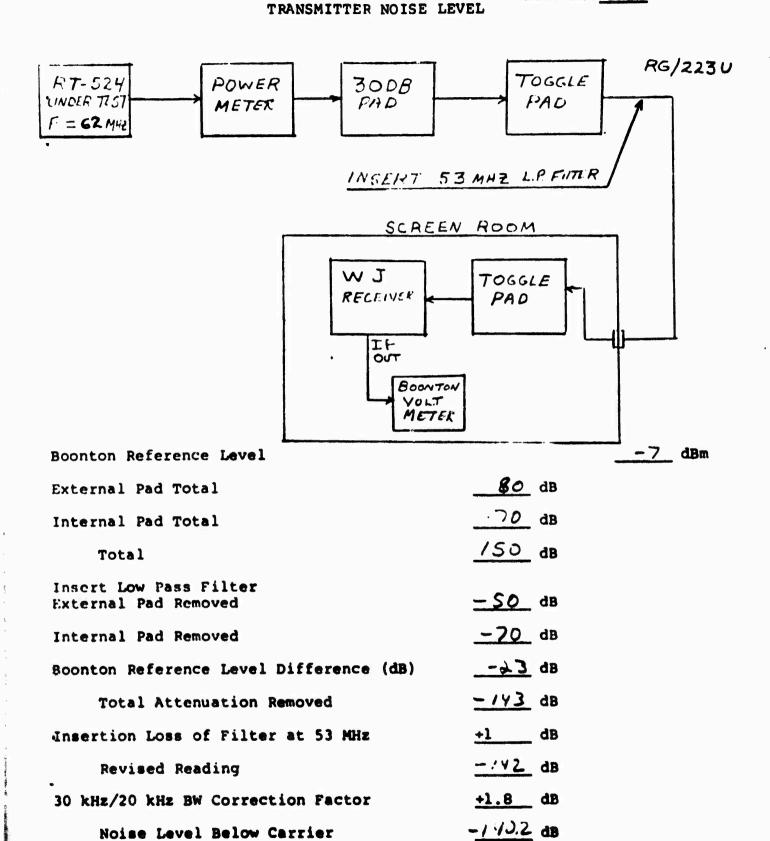


Figure 4.5-1

### SPURIOUS AND HARMONIC TEST

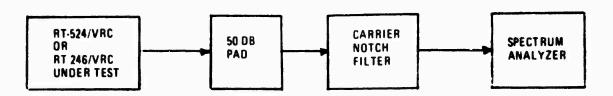

### HARMONIC TEST SET-UP

Set #1 RT-524/VRC

SPURIOUS: None visible

HARMONICS: Transmitter Frequency = 30 MHz

2nd Harmonic > -90 dB from carrier 3rd Harmonic ≈ -85 dB from carrier

Transmitter Frequency - 55 MHz
2nd Harmonic > -80 dB from carrier
3rd Harmonic -90 dB from carrier

Set #2 RT-246/VRC

SPURIOUS: None visible

HARMONICS: Transmitter Frequency = 30 MHz

2nd Harmonic > -90 dB from carrier 3rd Harmonic -86 dB from carrier

Set #3 RT-524/VRC

SPURIOUS: None visible

HARMONICS: Transmitter Frequency = 30 MHz

2nd Harmonic > -90 dB from carrier 3rd Harmonic -90 dB from carrier

Transmitter Frequency = 55 MHz

2nd Harmonic -90 dB from carrier 3rd Harmonic > -90 dB from carrier

### 5.0 CONCLUSIONS

The feasibility of retrofitting the power stages of the RT-524/VRC and RT-246/VRC with a solid state design has proven to be practical and desirable from the standpoint of reliability and efficiency. The power amplifier in its present form has withstood countless hours of operation during development and testing without a failure. The current drain of the modified unit at 7.5 amperes compares favorably to the typical 13 to 14 amperes drain of the unmodified unit.

There are three areas of investigation that are desirable before production of this unit is undertaken. The first would be the addition of an amplifier stage in the Tuner/Driver Assembly. The addition of a stage between the cascode amplifier and the driver would relax the performance requirements for ease in production.

A second area of improvement lies in a resonance condition at about 36 MHz which appears at the output of the Power Bridge. This resonance tends to cause a peak in the power output beyond the level control setting. This resonance would be moved out of band where it would have no effect.

The third is an evaluation of the interchangeability between manufacturers of the PA transistor. Only the TRW J01006 has been tried. It is recommended that the CTC device also be evaluated.

### DISTRIBUTION LIST

101	Defense Documentation Center ATTN: DDC-TCA Cameron Station (Pldg 5)	210	Commandant, Marine Corps HQ, US Marine Corps ATTN: Code LMC
*012		001	
104	Defense Communications Agency Technical Library Center	211	HQ, US Marine Corps ATTN: Code INTS
רהם		001	
•	Director	212	Command, Control & Comm Div Development Center
	National Security Agency ATTN: TDL	001	Marine Corps Dev & Educ Cmd Quantico, VA 22134
	Fort George G. Meade, MD 20755	214	Commander, Naval Air Sys Cmd
108	Director, Defense Nuclear Agency ATTN: Technical Library	001	Meteorological Div (AIR-05F) Washington, DC 20361
001	Washington, DC 20305	215	Naval Telecommunications Cmd
110	DCA/Defense Comm Engring Ctr 1860 Wiehle Ave	001	Tech Library, Code 422 4401 Massachusetts Ave, NW Washington, DC 20390
	Reston, VA 22090	301	Rome Air Development Center
200	Office of Naval Research Code 427	001	ATTN: Documents Library (TILD) Griffiss AFB; NY 13441
	Arlington, VA 22217	304	Air Force Geophysics Lab
201	Commander, Naval Ship Sys Cmd Technical Library, RM 3 S-08 National Center No. 3	001	L. G. Hanscom Field ATTN: LIR Bedford, MA 01730
001	Washingtor DC 20360		HQ ESD(DRI)
202	Naval Ships Engineering Center Code 6157D	001	L. G. Hanscom Field
001	Prince Georges Center Hyattsville, MD 20782		HQ, Air Force Electronic Warfare Center
205	Director Naval Research Laboratory ATTN: Code 2627		San Antonio, TX 78243 ATTN: SUR
001	Washington, DC 20375	313	Armament Dev & Test Center ATTN: DLOSL, Tech Library
206	Commander Naval Electronics Lab Center	001	Eglin Air Force Base, FL 32542
001.	ATTN: Library San Diego, CA 92152	314	HQ, Air Force Systems Cmd ATTN: DLCA Andrews AFB
. 07	Commander US Naval Ordnance Laboratory		Washington, DC 20331
.0.	ATTN: Technical Library White Oak, Silver Spring, MD 20910		Director Air University Library ATTN: AUL/LSE-64-285
	Parcegast to 7: 30-45 is expent is not established. E to mustic lists according to the open treating and expents	001	

318		422	
001	ATTN: EPECRW Mail Stop 105B Richards-Gebaur AFB,MO 64030		US Army Aeromedical Research Lab ATTN: Library
	Tribino odojo	001	Fort Rucker, AL 36362
	HQDA (DAMO-TCE)		
001	WASH, DC 20310	423	Commander US Army Armament Command
405	OSASS-RD		ATTN: DRSAR-RDP (Library)
001.	WASH, DC 20310	001	Rock Island, IL 61201
706	Commander	1,27	CDR, US Army Combined Arms
	US Army Training & Doctrine Cmd	7-1	Combat Developments Activity
001	ATTN: ATCD-SI	003	ATTN: ATCAIC-IE
QU <sub>3</sub>	Fort Monroe, VA 23651	003	Fort Leavenworth, KS 66027
1,07		429	
	US Army Training & Doctrine Cmd ATTN: ATCD-CI		US Army Logistics Center ATTN: ATCL-MA
001	Fort Monroe, VA 23651	001	Fort Lee, VA 23801
	HDQA (DAMA-ARP/Dr. F. D.	1.20	Common don't
	Verdeame)	430	Commandant US Army Ordnance School
001	WASH, DC 20310		ATTN: ATSL-CD-OR
703	Commander, DARCOM ATTN: DRCMA-EE	001	Aberdeen Proving Ground; MD 21005
	5001 Eisenhower Ave	L31	Commander
001	Alexandria, VA 22333		US Army Intelligence School
414	Commander	001	ATTN: ATSIT-CTD
HTH	US Army Training & Doctrine Cmd	001	Fort Huachuca, AZ 85613
	ATTN: ATCD-F	432	
001	Fort Monroe, VA 23651		US Army Field Artillery School ATTN: ATSFA-CTD
1,17	Commander, DARCOM	001	Fort Sill, OK 73503
	ATTN: DRCDE-OI (Mr. Speight)		
001	5001 Eisenhower Ave	433	CDR, US Army Aviation Sys Cmd ATTN: DRSAV-G
001	Alexandria, VA 22333		PO Box 209
1,19	Commander	001	St. Louis, MO 63166
	US Army Missile Command ATTN: DRSMI-RRA, Bldg 7770	1,35	Commandant
001	Redstone Arsenal, AL 35809	437	US Army Air Defense School
			ATTN: ATSA-CD-MC
12.1	CDR, US Army Missile Command Redstone Scientific Info Ctr	001	Fort Bliss, TX 79916
	ATTN: Chief, Document Section	436	Commandant
000	fiedstone Arsenal, AL 35809		US Army Engineer School ATTN: ATSE-CTD-DT-TL
		001	Fort Belvoir, VA 22060
			•

437	Commandant US Army Military Police School ATTN: ATSJ-CD-MC	.,,,	Director US Army Human Eng Labs
001	Fort Gordon, GA 30905	001	Aberdeen Proving Gd, MD 21005
442	Cdr, Harry Diamond Laboratories ATTN: Library	475	Commander HQ, Fort Huachuca ATTN: Tecnical Ref Div
001	2800 Powder Mill Road Adelphi, MD 20783	002	Fort Huachuca, AZ 85613
. 1778	Commander Picatinny Arsenal	476	Commander US Army Electronic Proving Gd ATTN: STEEP-MT
001	ATTN: SARPA-ND-A-4 (Bldg 95) Dover, NJ 07801	002	Fort Huachuca, AZ 85613
111.9	Commander	480	Commander USASA Test & Evaluation Ctr
44)	Picatinny Arsenal ATTN: SARPA-TS-S #59	001	Fort Huachuca, AZ 85613
002	Dover, NJ 07801	482	Commander US Army Communications Command
450	Commander Frankford Arsenal	001	ATTN: ACC-FD-M
	ATTN: Library, K2400,BL.51-2		Fort Huachuca, AZ 85613
	Philadelphia, PA 19137	483	ATTN: DRXRO-IP
452	Commander Frankford Arsenal	001	PO Box 12211 Research Triangle Park, NC 27709
001	ATTN: SARFA Z1000 (Mr. Kerensky) Philadelphia, PA 19137		•
	Commander		Cdr, US Army Research Office ATTN: DRXRO-PH (Dr. R. J. Lontz) PO Box 12211
422	White Sands Missile Range ATTN: STEWS-ID-S HQ	001	Research Triangle Park, NC 27709
001	White Sands Missile Range, NM 88002	488	US Army Security Agency ATTN: LARD
458	Dir/Dev & Engr Defense Systems Div ATTN: SAREA-DE-DDR, H. Tannenbaum	001	Arlington Hall Station Arlington, VA 22212
002	Edgewood Arsenal, APG, MD 21010	489	Commander
465	Commander Aberdeen Proving Ground	001	US Army Tank-Automotive Command ATTN: DRSTA-HW-L Warren, MI 48090
002	ATTN: STEAP-TL (Bldg 305) Aberdeen Proving Ground, MD 21005	190	Edgewood Arsenal
		001	ATTN: SAREA-TS-L Aberdeen Proving Ground, MD 21010

	Commandant US Army Air Defense School ATTN: C&S Dept, MSL SCI Div Fort Bliss, TX 79916	515	Director Joint Comm Office (TRI-TAC) ATTN: TT-AD(Tech Docu Ctr) Fort Monmouth, NJ 07703
496	CDR, US Army Combined Arms Combat Developments Activity	517	Commander US Army Missile Command
001	ATTN: ATCACC Fort Leavenworth, KS 66027	001	ATTN: AMSMI-RE (Mr. Pittman) Redstone Arsenal, AL 35809
500.	Commander US Army Yuma Proving Ground	519	Commander US Army Systems Analysis Agency
002	ATTN: STEYP-MTD (Tech Library) Yuma, AZ 85364	001	ATTN: DRXSY-T (Mr. A. Reid) Aberdeen Proving Ground, MD 21005
501	Commander US Army Arctic Test Center	525	Project Manager, REMBASS ATTN: DRCPM-RBS
002	ATTN: STEAC-PL APO, Seattle 98733		Fort Monmouth, NJ 07703
502	CO, US Army Tropic Test Ctr ATTN: STETC-MO-A (Tech Library)	526	Project Manager, NAVCON ATTN: AMCPM-NC-TM (T. Daniels) Bldg 2539
001	Drawer 942 Fort Clayton, Canal Zone 09827	001	Fort Monmouth, NJ 07703
505	CDR, US Army Security Agency ATTN: IARD-IT	596	Commandant US Army Sig School ATTN: ATSN-CTD-MS
001	Arlington Hall Station Arlington, VA 22212	002	
509		598	US Army Satellite Comm Agency
001	US Army Logistics Center ATTN: ATCL-MC Fort Lee, VA 22801	001	ATTN: DRCPM-SC-3 Fort Monmouth, NJ 07703
		599	TRI-TAC Office
511	Commander US Army Nuclear Agency Fort Bliss, TX 79916	001	ATTN: CSS (Dr. Pritchard) Fort Monmouth, NJ 07703
			ECOM Liaison Office
215	Directorate of Combat Developments US Army Armor School ATTN: ATZK-CD-MS	001	US Army Electronic Proving Gd Fort Huachuca, AZ 85613
	Fort Knox, KY 40121	#60 <u>4</u>	ECOM Liaison Office MIT, Bldg 26, Rm 131
513	Commandant US Army Aviation School ATTN: ATST-D-MA	001	77 Massachusetts Avenue Cambridge, MA 02139
001	Fort Rucker, AL 36360	605	ECOM Liaison Office MIT-Lincoln Laboratory, Rm A-117
514	Commandant	003	PO Box 73
001	US: Army Inst for Mil Assistance ATEN: ATSU-CTD-OMS Fort Bragg, NC 28307	ωĭ	Lexington, MA 02173

680 Commander US Army Electronics Command 000 Fort Monmouth, NJ 07703 1 DRSEL-PL-ST 1 DRSEL-VL-D 1 DRSEL-PP-I-PI 1 DRSEL-WL-D 1 DRSEL-TL-D 3 DRSEL-CT-D 1 DRSEL-BL-D \*3 DRSEL-NL-RN-1 1 DRSEL-NL-D-8 (Ofc of Record) 1 DRSEL-SI-CM 1 DRSEL-MA-MP 2 DRSEL-MS-TI 1 DRSEL-GG-TD 1 DRCPM-AA 1 DRSEL-CG (Mr. Doxey) 2 DRSEL-PA 1 DRCPM-TDS-SE 1 USMC-LNO 1 DRSEL-GS-H 1 DRSEL-RD

ment anument appointed in country. Was COLIN'S

TRADOC-LNO

701 MIT - Lincoln Laboratory ATTN: Library - Rm A-082 POB 73

OOl Lexington, MA 02173

703 NASA Scientific & Tech Info Facility ATTN: Acquisitions Br (S-AK/DL)

002 College Park, MD 20740

706 Adviscry Group on Electron Devices ATTN: Secy, Working Grp D (Lasers) 201 Varick St

002 New York, NY 10014

713 R. C. Hansen, Inc. PO Box 215

001 Tarzana, CA 91356

714 Ketron, Inc. ATTN: Mr. G. Schecter 1400 Wilson Blvd, Architect Bldg

001 Arlington, VA 22209

718 TACTEC
Battelle Memorial Institute
505 King Ave

001 Columbus, OH 43201

720 CANDAS
Purdue Industrial Research Park
2595 Yeager Rd.

001 W. LaFayette, IN 47906

Dept. of the Navy
Naval Electronic Laboratory
Center
ATTN: Robert Jordan
271 Catalina Blvd.
001 San Diego,

HISA-FM